

RUGER-57™ PISTOL PRODUCT SAFETY BULLETIN



Ruger has discovered that a small number of Ruger-57 pistols may have right safety levers that do not meet our specifications and may be prone to cracking. Although only a very small number of pistols appear to be affected, Ruger is committed to safety and is asking owners of Ruger-57 pistols to perform a routine function check of the safety lever to ensure its proper operation and, if necessary, sign up for this retrofit. Details about what to look for and how to sign up for the retrofit appear below and on our website at Ruger.com/Ruger-57Retrofit.

PRODUCTS SUBJECT TO THIS SAFETY BULLETIN:

Potentially affected pistols include any Ruger-57 pistol with a serial number of 642-26274 or lower (including all Ruger-57 pistols with a "641" prefix). If your Ruger-57 pistol is within this range (641-00000 to 642-26274), you should follow the inspection procedure outlined below to determine whether your pistol requires a retrofit. **Ruger-57 pistols with a serial number of 642-26275 and above are not affected by this Safety Bulletin.**



DESCRIPTION OF THE ISSUE:

In some rare instances, the internal "leg" of the right safety lever may crack or break, rendering the safety ineffective. If present, this condition may cause the safety to appear to be functioning properly when it is not. Although Ruger already instructs owners of Ruger-57 pistols to perform a function check before each use, we are requesting that all owners of potentially affected pistols perform this safety inspection immediately.


HOW TO INSPECT YOUR PISTOL:

BEFORE YOU BEGIN, BE SURE YOUR PISTOL IS UNLOADED AND THERE IS NO LIVE AMMUNITION IN YOUR WORKSPACE.

1. With the pistol pointed in a safe direction, remove the magazine and place the safety in the "fire" position.
2. Retract the slide and lock it to the rear using the slide stop.
3. Visually and physically inspect the chamber to ensure there is no ammunition present.
4. Retract the slide slightly and release to allow the slide to close on an empty chamber.
5. Engage the safety (see Figure 1) by pushing up on the manual safety. Ensure it moves up fully and "clicks" into place.



6. With the pistol pointed in a safe direction, pull the trigger firmly, but do not force it beyond the point where you meet resistance. The trigger should be blocked and the hammer should not fall (see Figure 2A).

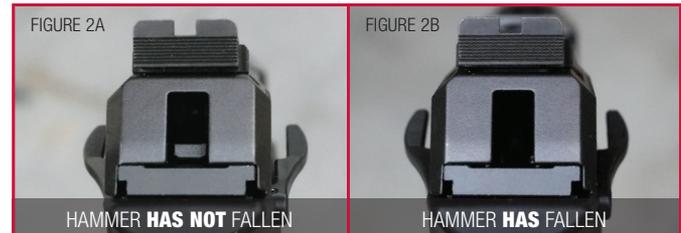

7. If the trigger is blocked and the hammer does not fall, no further action is required, but you should regularly perform this, and all other function checks described in your instruction manual as a part of your normal inspection process.

IF, WITH THE SAFETY ENGAGED, YOU ARE ABLE TO PULL THE TRIGGER AND THE HAMMER FALLS (SEE FIGURE 2B), OR IF YOU ARE UNSURE, PLEASE DO NOT USE YOUR PISTOL AND IMMEDIATELY SIGN UP FOR THE RETROFIT AT RUGER.COM/RUGER-57RETROFIT OR BY PHONE AT 336-949-5200.

Ruger reminds consumers that periodic inspection and function checks of any firearm is important to ensuring its safe operation. It is important to frequently perform regular function checks as described in your instruction manual, and to clean and inspect your firearm after each range session. Proper maintenance increases the longevity of your firearm and will allow early detection of worn or broken parts.

Ruger also reminds consumers to always treat every firearm as though it is loaded and always keep the muzzle pointed in a safe direction. Never rely upon any safety or mechanical device to justify unsafe or careless firearm handling.

HOW TO SIGN UP FOR THE RETROFIT:

STEP 1: If your pistol fails the function check listed above (you are able to pull the trigger and release the hammer with the safety engaged), please do not use your pistol, and sign up for the retrofit at Ruger.com/Ruger-57Retrofit or by phone at **336-949-5200**.

STEP 2: Our Customer Service team will issue you an RMA and send you a pre-paid shipping label to return your pistol for service.

STEP 3: We will perform all required safety updates and will make every effort to return your pistol within one week of when we receive it.

If you have any questions regarding this Safety Bulletin, please visit the FAQ's and inspection video on our website at Ruger.com/Ruger-57Retrofit. If you need assistance signing up for the retrofit, please contact Customer Service at **336-949-5200**.